

## HOW TO POSITION THE SPRING COIL END CORRECTLY

BMW5 E39 front




FI077EU


If the spring coil end is **NOT CORRECTLY** positioned, this will lead to a wrong vehicle height:

### IMPORTANT :


- Before disassembling the strut assembly we strongly recommend putting vertical colour marks on all the assembly parts.
- These marks should be vertically aligned with the centre of the groove in the shock absorber spring seat.
- During the assembly of the new shock absorber, all parts have to be put back so that the colour marks on all parts are again aligned with the groove of the new shock absorber spring seat.

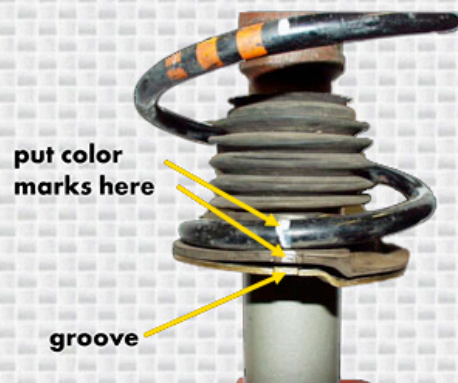

- If you do not follow these instructions, the following situation could occur :

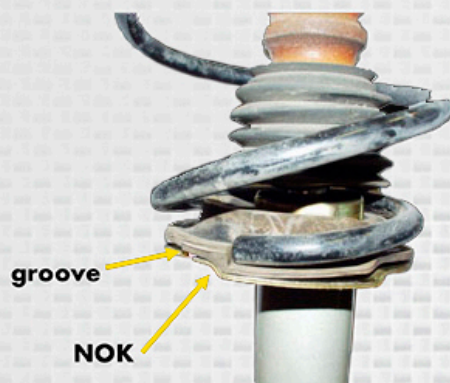

1 - Spring coil end **wrongly positioned.**

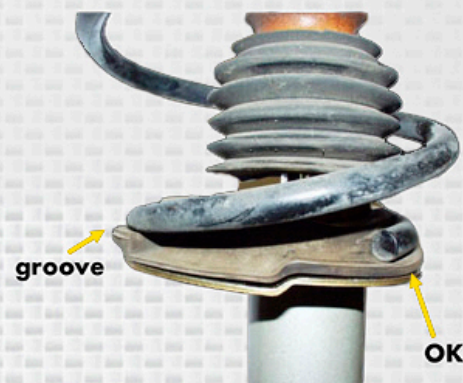

2 - Spring coil end **in the correct position.**

- If using new components, please note the position of the original parts when removing them.