■ febi 101325,106911

Nissan Qashqai 2013 > (J11) model, X-Trail 2014 > (T32) Engine: K9K, R9M



(EN)







Fig. 2 febi 106911

Fuel Filter

Problem

The water in fuel, lamp is illuminated on the vehicles dashboard display after the fuel filter has been replaced.

Cause

The incorrect filter has been fitted to the vehicle during servicing, due to a change in specification with the fuel heater/water sensor installed in the filter. This effects Qashqai models built from August 2014 and X-Trail models from December 2014.

Solution

The correct fuel filter required for the Qashqai models built before August 2014 and X-Trail models before December 2014 can be identified by a black fuel heater/ water sensor inbuilt into the filter (Fig 1).

The correct fuel filter required for the Qashqai models built after August 2014 and X-Trail models built after December 2014 can be identified by a white fuel heater/ water sensor inbuilt into the filter (Fig 2).

For more technical information please visit: partsfinder.bilsteingroup.com