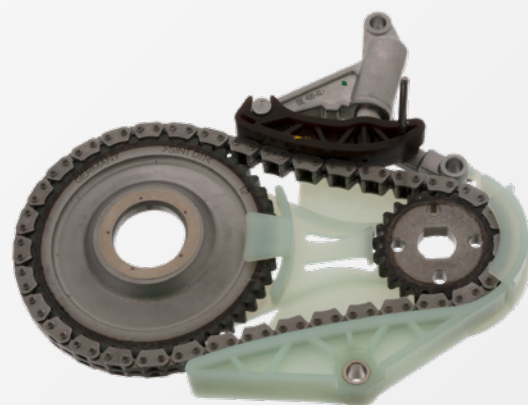


SWAG 30 93 8362, 20 94 6140

To fit:

BMW E84, E89, F10, F25, F30 fitted with
N20 & N26 Engines

SWAG®


EN

Timing Chain Kit, Chain Kit for oil pump

Problem

High pitch whining noise from the lower engine area near the engine oil pump, which increases in frequency as the engine RPM increases.

Cause

Engine oil pump chain drive sprockets worn.

Solution

Remove and inspect timing chain and oil pump drive sprockets, guides, tensioners & chains for wear. Replace the worn engine oil pump chain drive module (20 94 6140) and timing chain kit (30 93 8362) following the vehicle manufacturers procedures and replace engine oil & filter.

For more technical information please visit: partsfinder.bilsteingroup.com