

to fit:

Land Rover Defender / Discovery 1 90/110/130 2.5DT 200/300 Tdi 1989>1998>





CLUTCH KIT OR CLUTCH RELEASE FORK REPLACEMENT

Symptom

The clutch pedal goes solid and it becomes awkward to select gears. The clutch pedal is depressed and does not return to the correct height.

On manually lifting the pedal back into position it goes solid, and it is then not possible to be pushed down in order to release the clutch pressure plate.

Cause

On removal of the gearbox, the clutch release fork may have worn through at the pivot point.



Remedy

The clutch fork will need replacing (Blue Print ADJ133302).

It is best practice to check the condition of the clutch assembly and spigot bush and replace as necessary whilst the gearbox is removed.

Ensure the pivot is lubricated with a small amount of suitable grease prior to re-assembly.

For more technical information please visit: partsfinder.bilsteingroup.com