

## ContiTech

### Attention in the Installation of Belt CT879

Vehicles Fiat Palio/ Weekend/ Siena/ Strada - engine 1.6 16V

#### Problem:

Reduction of the original width of the belt generated by the wear side. In some cases breakage of the belt.

Original Belt Width: **25.4 mm**.  
Verified the belt width: **11.32 mm**

#### Cause:

Stud and or fixing the tensioner plate with angular misalignment.

Gaps in fixing the fairing or between the axes of rotation of the timing system require the parties to have contact between the fairing generating wear on the side of the belt.

#### Solution:

The tensioner should be installed with proper tools. The code is 1860876000 Fiat tool.

The tensor must be in the correct working position.

