SWAG 62 93 6070

to fit:

Various Citroën, Fiat, Ford, Lancia, Landrover, Mitsubishi and Peugeot models






Part Description: Magnet Wheel for Crankshaft



Attention!

A magnetic reluctor is extremely sensitive to any cleaning or handling. As a result, it may become faulty which can lead to an incorrect crankshaft sensor speed signal. This can result in an engine management malfunction with a fault being logged, such as fault code P0336. (An example of a faulty reluctor with damaged magnetic segments is found above). SWAG recommends replacing the crankshaft magnetic reluctor wheel at the same time as the routine replacement of the timing belt and/or the torsion vibration damper (TVD) pulley.

SWAG offers this part singularly or as part of a kit to include the TVD and bolt (62 93 6433 or 62 10 6476). This combination kit enables a professional repair and avoids potential complaints. This saves time and money for both workshop and customer!

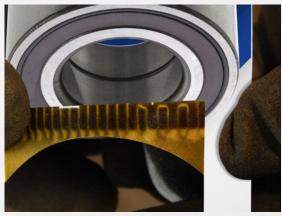

Example of a faulty reluctor using a magnetic test card

For more technical information please visit: partsfinder.bilsteingroup.com