

Technical Bulletin

FAI Cylinder Heads

Affected part numbers: BCH029, BCH030, BCH032 & BCH104


Some applications have auxiliary components that use the oil feed hole as shown below. If the application you're working on doesn't require this function, the hole must be plugged with the screw and washer provided.

Failure to do so will result in a loss of oil & oil pressure and any damage, as a result, will void the FAI warranty.



Warning!

Check Fitment

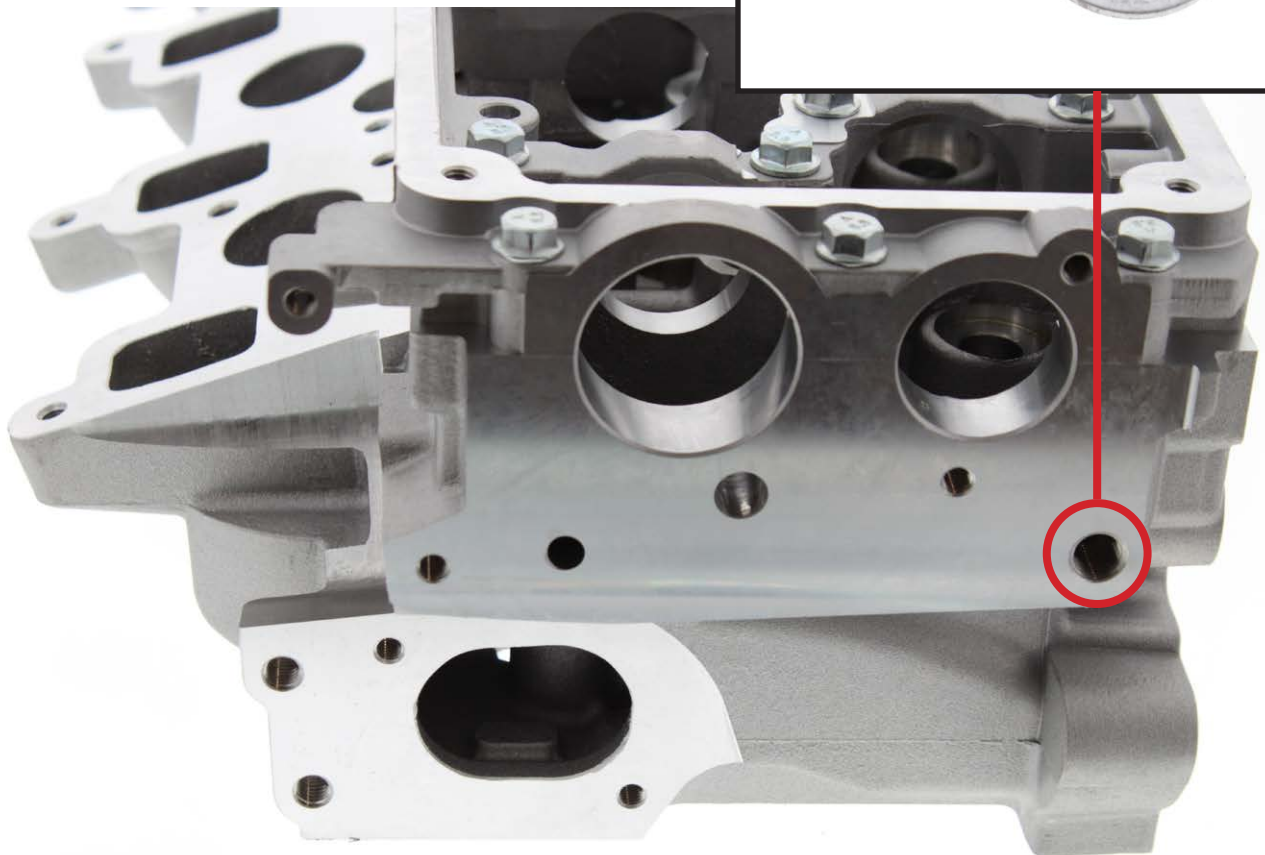

TB0061

+44 (0) 1525 351800



faiauto.com