



AUTOELECTRO

Since 1986


STARTER MOTORS & ALTERNATORS

IMPORTANT PLEASE READ THE INFORMATION BELOW BEFORE FITTING THIS PART AS THERE IS A KNOWN ISSUE WHICH WILL RESULT IN THE PREMATURE FAILURE OF THE UNIT AND MAY INVALIDATE YOUR WARRANTY

The vehicle this alternator is fitted to has a known fault within the drive belt system that results in a tensioning issue causing the alternator pulley to split.

The fault can cause the alternator warning lamp to illuminate and can also result in excessive noise within the drive belt system.

It is recommended that the drive belt system is checked for any defects and the drive belt is replaced when the alternator is replaced if there are any signs of belt slip, alternator pulley has failed, bearings have failed or the alternator has developed a noise. Failure to carry out the above remedial work will result in the premature failure of the alternator pulley and may invalidate your warranty.

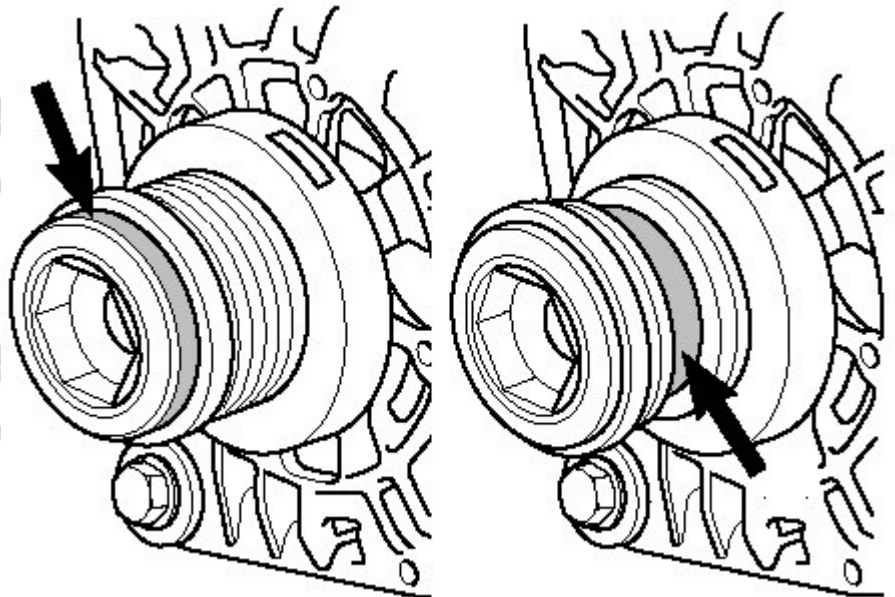

FREE vehicle specific technical information is available by visiting autoelectro.co.uk OR scan this QR code



The Original and Best
Since 1986