




Das Original

TSI 02/08

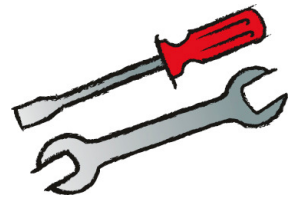

Cam cover gasket for OM 400 Mercedes-Benz

For years, these engines are fitted ex factory with the technically high-quality **Metaloseal gasket** **977.438**. This gasket has a thickness of 0.4 mm. Valve covers must not show any warpage.

Oil leakage may be observed in high-mileage engines as a result of warped cam covers.

If the cam covers are not surfaced, it is recommended to install the cam cover gasket made of **EWP soft material** **476.050**. With a thickness of 1.5 mm, this cam cover gasket compensates for component distortion more effectively.



Soft material 1.5 mm
 476.050



Metaloseal 0.4 mm
 977.438