

STRUT MOUNTING KIT 825100S

TECHNICAL INFO NO. 1066

VEHICLE MANUFACTURER / MODEL:

Mercedes | A-Class

AFFECTED ENGINES:

W 168

AFFECTED ARTICLES:

RUVILLE No.:	OE No.:
825100S	1683200373

REQUIRED MOUNTING KIT:

RUVILLE No.:	OE No.:
855102	1683230271

IMPORTANT NOTE!

To simplify installation, the fastening holes already have a thread, in contrast to the original part.
Please include mounting kit 855102 in your order as this contains the screws without tapping characteristics.
Please comply with the instructions issued by the vehicle manufacturer!

After replacing the strut mounting in the Mercedes A-Class, frequently noises are heard from the strut mounting, the springs jump on turning the steering wheel, the steering becomes stiffer and failure of the new part is even possible. This is caused by failure to comply with the correct installation direction, resulting in tensions.



Figure 1

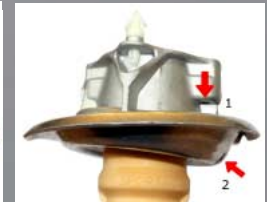


Figure 2



Figure 3



Figure 4

Please comply with the following instructions for correct alignment of the strut mounting:

- The longer rib (Fig. 1) must be aligned with recess 2 (Fig. 2).
- The threaded hole 1 must be in line with recess 2 (Fig. 3).
- If the part is incorrectly turned through 180° it will be fitted at a tilted angle (Fig. 4) with the above consequences.

Attributes:

- Complete repair kit
- Fastening holes already with thread
- OE-quality part



INFORMATION

Corresponding spare parts can be found in our online catalogue at www.ruville.de

Where reference is made to the spare parts numbers of the vehicle manufacturers, this is only for the purposes of comparison.