


SWAG 32 92 2500

to fit:
 Audi A3 / Sportback (OE ref. 1K0 412 331 B)
 Seat Altea, Toledo (OE ref. 1K0 412 331B)
 Skoda Octavia (OE ref. 1K0 412 331B)
 VW Caddy, Golf 5 / Plus, Touran
 (OE ref. 1K0 412 331 B)

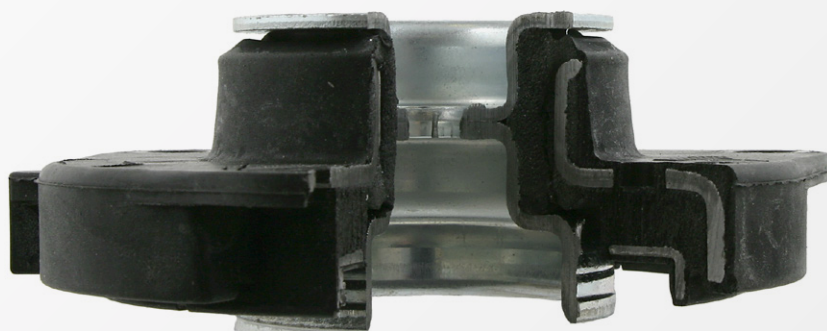

EN

Strut Top Mounting

Problem

Noise and squeaking from the front axle, even with original VW parts.

Cause



These problems are caused by poor manufacturing and use of inferior materials. Mostly, the rubber metal compound dissolves due to insufficient vulcanization. This leads to a high failure rate.

Solution

SWAG recommends to use the strut top mounting SWAG 32 92 2500 (OE ref. 1K0 412 331 B). The SWAG strut top mounting is characterised by the use of high-grade material and professional manufacturing. Material and manufacturing exceed the car manufacturers' requirements. SWAG strut top mountings are also very durable.

Attention

The strut top mounting bearing (SWAG Nr. 32 92 2498) should also be replaced! The repair kit SWAG 32 92 2502 contains all components which should be replaced, strut top mounting (32 92 2500) and ball bearing (32 92 2498).

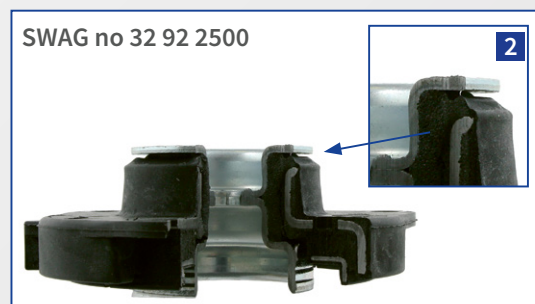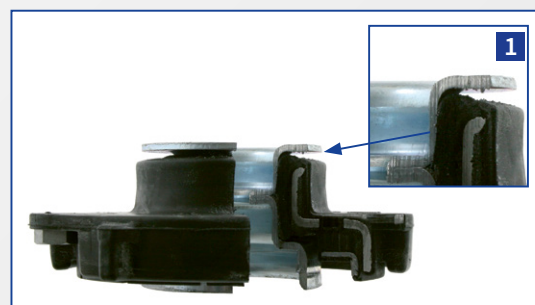

SWAG no 32 92 2500



Repair kit
 SWAG NO. 32 92 2502

For more technical information please visit: partsfinder.bilsteingroup.com