Technical Bulletin

Mitsubishi Shogun, Pajero – Front Wheel Bearing Fitment Guide Applicable References: ADC48226 Applications: Mitsubishi Shogun/Pajero – Chassis ref: V64, V65, V68, V75, V78 1999>2006 Date Issued: 05/2007

Subject – Application Guide

Vehicle - Mitsubishi Shogun & Pajero models 2000>

We have encountered several cases of reported "Hub bearing failures" on some Mitsubishi Shogun / Pajero models, Model Year 2000>.

The fitting instructions supplied with the Hub assembly must be followed to ensure correct installation of the Hub assembly. Following the fitting instructions will limit the possibility of any future warranty failures.



Fitment Procedure

1. Fit the washer on the Hub assembly, with the washer's chamfered face towards the castle nut.

See Image (on right).

2. Tighten the castle nut to 200±10Nm.

Please Note:


When fitting the Hub assembly, care must be taken NOT to allow the vehicle weight to be placed onto the Hub assembly before tightening the castle nut. Doing so may result in damage to the bearing.

ADC48226 Mitsubishi Model Applications:

- Shogun V64, V68, V78, V65, V75.
- Pajero V68, V78, V65, V75.



Correct position of washer

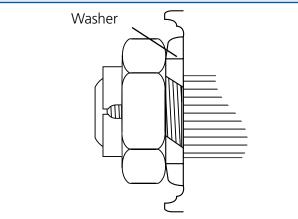



Disclaimer : Any technical tips are produced in good faith. Ferdinand Bilstein UK Ltd. always recommend that vehicle maintenance and diagnostics are only carried out by suitably experienced people using appropriate tools in a safe manner within a workshop environment. Ferdinand Bilstein UK Ltd. and their customers cannot be held responsible for the correctness of, or misinterpretation of the above technical tips. Images shown are for illustrative purposes only and may not be representative of the products or vehicles described.